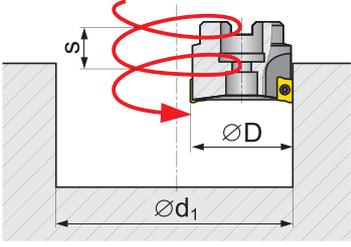
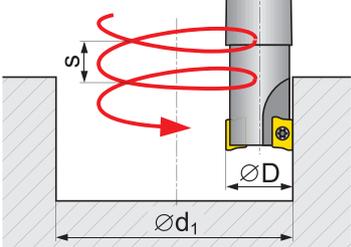


Eintauchen durch Spiralbewegung	Werkzeug	WSP	Fräser- durch- messer	d _{min}	d _{max}	S _{max}	
			[mm]				
Aufsteckfräser							
		ZDCW 09...	40	64	76	0,4	
		ZDEW 12...	50	79	96	0,7	
			63	105	122	0,75	
		RD... 12...	52	82	102	2,8	
			66	110	132	2,8	
		RD... 16...	80	136	160	2,8	
			52	74	104	4,0	
			66	102	132	4,0	
			80	130	160	4,0	
	100	170	200	4,0			
	Schaftfräser						
			ZDCW 09...	25	34	48	0,4
32			48	60	0,4		
		ZDEW 12...	32	43	62	0,65	
			40	59	78	0,65	
		RDHX 05...	10	12	20	1,0	
			12	16	24	1,0	
			15	22	32	1,0	
		RD... 07...	15	17	30	1,4	
			20	28	40	1,4	
			25	38	50	1,5	
		RD... 10...	20	22	40	2,5	
			25	32	50	2,5	
			30	42	60	2,3	
		RD... 12...	35	52	70	2,5	
			24	26	48	3,0	
			35	46	70	3,0	
		RD... 16...	42	62	82	3,5	
			32	34	64	4,0	
	35		40	70	4,0		